


Переходы по ОСТ 34 10.700-97

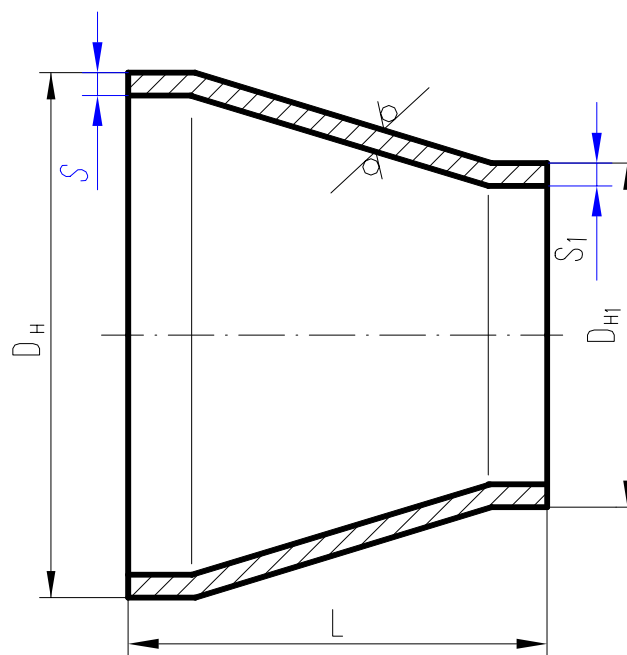

Материал: трубы бесшовные по ТУ14-3-190-2004 из стали марки 20 по ГОСТ1050-88

Параметры среды: P_y 4 МПа (40 кгс/см²);

Обозначение	Условн. проходы $D_y \times d_y$	D_H	D_{H1}	S	S_1	L	Масса, кг
ОСТ 34 10.700-97	40x25	45	32	2,5	2,0	30	0,1
	50x40	57	45	4,0	2,5	60	0,2
	50x32	57	38	4,0	2,0	50	0,2
	65x50	76	57	3,5	3,0	70	0,4
	65x40	76	45	3,5	2,5	70	0,4
	80x50	89	57	3,5	3,0	75	0,6
	80x65	89	76	3,5	3,5	75	0,6
	100x65	108	76	4,0	3,5	80	0,9
	100x80	108	89	4,0	3,5	80	1,0
	125x80	133	89	4,0	3,5	100	1,5
	125x100	133	108	5,0	4,0	100	1,7
	150x100	159	108	5,0	4,0	130	2,6
	150x125	159	133	5,0	4,0	130	2,8
	200x125	219	133	7,0	4,0	140	4,6
	200x150	219	159	7,0	5,0	140	6,2
	250x200	273	219	8,0	7,0	180	10,2
	300x200	325	219	10	8,0	180	14,0
	300x250	325	273	10	8,0	180	15,0
	350x200	377	219	12	8,0	300	29,5
	350x250	377	273	12	10	220	23,3
	350x250	377	273	12	10	300	31,7
	350x300	377	325	12	10	300	34,0
	350x300	377	325	12	10	220	24,9
	400x300	426	325	12	10	220	31,2
	400x300	426	325	12	10	350	42,7
	400x350	426	377	12	12	220	33,4
	400x350	426	377	12	12	350	45,5